

**2006~2009 FJR1300 MODELS A/AC/AE/AEC  
FACTORY MODIFICATION CAMPAIGN – Ground Wire Junction  
Yamaha Technical Bulletin M2011-003R**

Yamaha Motor Corporation, U.S.A. posts this notice as a service to Yamaha customer and potential customers. Yamaha Motor Corporation, U.S.A. has decided that a possible defect relating to safety may exist in all 2006, 2007, 2008, and 2009 FJR1300 A/ AE motorcycles. This bulletin was originally issued on July 8, 2011.

**Affected Models:**

FJR1300AV/AW/AX/AY  
RP15E-000003~0006820

FJR1300AVC/AWC/AXC/AYC  
RP15Y-000001~001218

FJR1300AEV/AEW/AEX/AEY  
RP16E-000006~001736

FJR1300AEVC/AEWC/AEXC/AEYC  
RP16Y-000005~000306

**The reason for this recall:** On affected motorcycles, the ground joint connector of the wire harness could overheat and become deformed, possibly causing an intermittent ground wire connection. If the electrical system is not properly grounded, the ignition system and/or other electrical components could malfunction, which could cause the engine to stall. If this happens while the motorcycle is being ridden, there could be a crash resulting in injury or death.

**What Yamaha and your dealer will do:** To correct this defect, Yamaha is initiating a Factory Modification Campaign. Affected motorcycles must have an additional wire sub-lead installed or, if the ground joint connector has already been damaged from overheating, have the main wire harness replaced.

**What you should do now:** Please call your Yamaha dealer to make a service appointment to have this procedure performed. At that same time, you can find out how long they expect to keep your motorcycle for this service.

**You should not ride your motorcycle until this modification is performed.**

If you are unable to return to the Yamaha dealer who sold you the motorcycle, this service will be performed by any authorized Yamaha Motorcycle dealer. For the name of a dealer near you, call 1-800-88-YAMAHA or visit the Dealer Locator section of this website.